

Airplane Group, P.O. Box 3707, Seattle, Washington 98124-2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(e) This amendment becomes effective on March 16, 1995.

Issued in Renton, Washington, on January 19, 1995.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 95-1846 Filed 2-13-95; 8:45 am]

BILLING CODE 4910-13-U

14 CFR Part 39

[Docket No. 94-CE-16-AD; Amendment 39-9123; AD 95-02-05]

Airworthiness Directives; Jetstream Aircraft Limited (Formerly British Aerospace, Regional Airlines Limited) HP137 Mk1, Jetstream Series 200, and Jetstream Models 3101 and 3201 Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that applies to Jetstream Aircraft Limited (JAL) HP137 Mk1, Jetstream series 200, and Jetstream Models 3101 and 3201 airplanes. This action requires repetitively inspecting the passenger/crew cabin door handle mounting platform structure for cracks, and, if found cracked, replacing with a structure of improved design as terminating action for the repetitive inspections. The actions specified by this AD are intended to prevent the inability to open the passenger/crew door because of a cracked internal handle mounting platform structure, which, if not detected and corrected, could result in passenger injury if emergency evacuation was needed.

DATES: Effective March 17, 1995.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 17, 1995.

ADDRESSES: Service information that applies to this AD may be obtained from Jetstream Aircraft Limited, Manager Product Support, Prestwick Airport, Ayrshire, KA9 2RW Scotland; telephone (44-292) 79888; facsimile (44-292) 79703; or Jetstream Aircraft Inc., Librarian, P.O. Box 16029, Dulles International Airport, Washington, DC, 20041-6029; telephone (703) 406-1161;

facsimile (703) 406-1469. This information may also be examined at the Federal Aviation Administration (FAA), Central Region, Office of the Assistant Chief Counsel, Room 1558, 601 E. 12th Street, Kansas City, Missouri 64106; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Mr. Raymond A. Stoer, Program Officer, Brussels Aircraft Certification Office, FAA, Europe, Africa, and Middle East Office, c/o American Embassy, B-1000 Brussels, Belgium; telephone (322) 513-3830; facsimile (322) 230-6899; or Mr. John P. Dow, Sr., Project Officer, Small Airplane Directorate, Airplane Certification Service, FAA, 1201 Walnut, suite 900, Kansas City, Missouri 64106; telephone (816) 426-6932; facsimile (816) 426-2169.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that would apply to certain JAL HP137 Mk1, Jetstream series 200, and Jetstream Models 3101 and 3201 airplanes was published in the **Federal Register** on October 13, 1994 (59 FR 51879). The action proposed to require repetitively inspecting the passenger/crew cabin door handle mounting platform structure for cracks, and, if found cracked, replacing with a structure of improved design as terminating action for the repetitive inspections. The proposed actions would be accomplished in accordance with Jetstream Service Bulletin 52-A-JA 930901, Revision 1, dated February 11, 1994.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposed rule or the FAA's determination of the cost to the public.

After careful review of all available information, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed except for minor editorial corrections. The FAA has determined that these minor corrections will not change the meaning of the AD nor add any additional burden upon the public than was already proposed.

The FAA estimates that 165 airplanes in the U.S. registry will be affected by this AD, that it will take approximately 1 workhour per airplane to accomplish the required action, and that the average labor rate is approximately \$55 an hour. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$9,075. This figure does not take into account any possible

passenger/crew door internal handle mounting platform structure replacements nor repetitive inspections. The FAA has no way of determining how many of these structures may have cracks or the number of repetitive inspections each owner/operator may incur.

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the final evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. App. 1354(a), 1421 and 1423; 49 U.S.C. 106(g); and 14 CFR 11.89.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding a new AD to read as follows:

95-02-05 Jetstream Aircraft Limited:

Amendment 39-9123; Docket No. 94-CE-16-AD.

Applicability: HP137 Mk1, Jetstream Series 200, and Jetstream Models 3101 and 3201 airplanes (all serial numbers), certificated in any category. Compliance: Required upon the